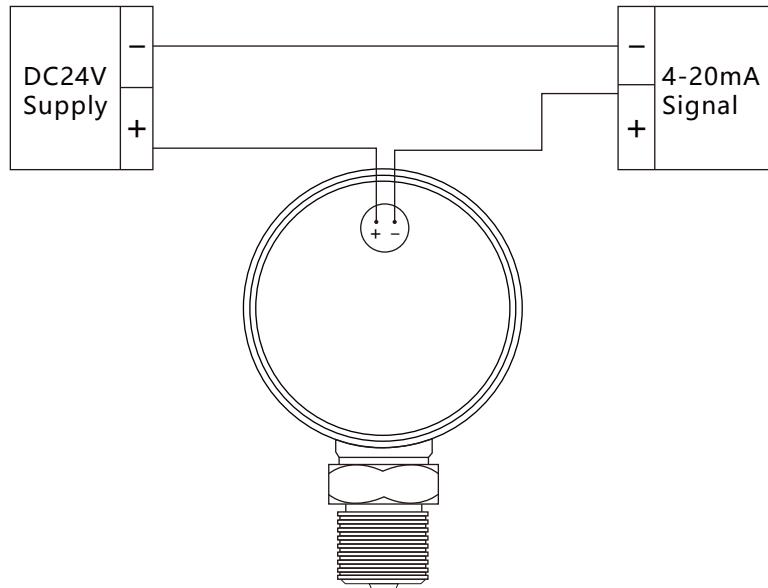


WIRING INSTRUCTION

- ※ Please refer to the label on the rear of the instrument .
- ※ The 4-20mA signal terminal must be connected in series, otherwise the meter will not be powered on.

HOW TO ZERO?

Press and hold "ZERO" for 3 seconds.

FAQ

1. If the screen still display the pressure value under the zero pressure state. It is because of the slight error caused by the different atmospheric pressures in various places, which does not affect the normal use. (Please make sure that the instrument is not connected to the pressure pipeline, otherwise it will increase the equipment error.)
2. If the output mA number of the device is lower than the normal value. It may be because the power supply voltage has not reached 24V. Please check the power supply equipment.